

Application: E4OD/ 4R100

8380 Tiogawoods Drive
Sacramento, CA 95828

Subject: Solenoid block identification

ph 800.852.3351
fx 916.681.7710

WWW.PDQPARTS.COM

Technical Bulletin

E4OD/ 4R100 Solenoid Blocks

57343-OE	1989-94	E4OD Solenoid Block (Early Connector)
57343A-OE	1995-98	E4OD Solenoid Block (Late Connector)
57343A-OE	1998-up	4R100 Solenoid Block (Non-PWM)
57343B-OE	1998-up	4R100 Solenoid Block (PWM)



57343-OE (89-94)

Connector:
Clips on both sides
Non-PWM:
all solenoids the same



57343A-OE (95-up)

Connector:
Clip on one side
Non-PWM:
all solenoids the same



57343B-OE (98-up)


Connector:
Clip on one side
PWM:
Bottom right solenoid is different.

↑
TCC Solenoid is different from other three.

4R100 PWM Solenoid Update:

Diesel January 1998-up
Gas 1999-up

The PWM solenoid block has undergone two updates. The latest update has an orange plastic cover. Do not use earlier design solenoid blocks; early designs will cause shifting problems.

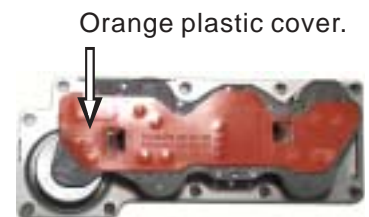

Orange plastic cover.